

Technical Bulletin

Bulletin Number: 324 Revision Number: R-02

Release Date: June 18, 1987 Revision Date: July 27, 1999

SUBJECT: POLARIZATION OF WIRING HARNESS (POWER HARNESS & CABINET HARNESS)

MODELS AFFECTED: All DNCB Venders

REASON: To provide serial breaks for start up of polarized harnessing. The line or hot line is #2 wire which is the smaller terminal / socket in the harness.

- | | | |
|--|-------------|---|
| Coke Venders: | 0001-2569CG | Polarized harnessing started on Coke venders with 12 oz. Can capacity of 300 or more. The EMS (Energy Management System) was started at this time also. Polarization was essential for the EMS harness. |
| | 0001-2986BL | Polarized harnessing started on Coke venders with 12 oz. Can capacity less than 300. The EMS (Energy Management System) was discontinued on Coke venders at this time. |
| Pepsi, 7UP, Dr. Pepper, & Generic Venders: | | Polarization undetermined; occurred approximately 1984. |


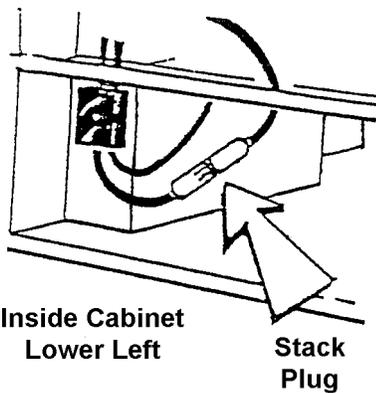


Figure 1

 


**Cylinder Plug
Figure 2**

**Cylinder Cap
Figure 3**

When a non-polarized power harness is replaced with a polarized power harness, order 804,901,95x.x1 adapter lead standard female on one end and polarized male on the other end. When a non-polarized cabinet harness is replaced with a polarized cabinet harness, order 804,901,96x.x1 adapter lead standard male on one end and polarized female on the other end.



 804,901,96x.x1



804,901,95x.x1