

Technical Bulletin

Bulletin Number: 338 Revision Number: R-04

Release Date: December 2, 1987 Revision Date: December 7, 1998

SUBJECT: 588 / 489 ROTOR AND CAN STOP SHIM

MODELS AFFECTED: All DNCB 588 and 489 Models

BEGINNING SERIAL NUMBER: 0001-2999CL to 0001-3198AN consist of the new rotor and shim factory installed.

REASON: The vend rotor was revised to improve the vending of the first (front) can or bottle. The vend rotor was revised to advance its travel to improve this. The shim was lowered to prevent the shim from interfering with the rotor as it turns.


NOTE: *If a vending problem occurs in a 588 or 489 serialized 0001-2931DK to 0001-2999CL, replace the rotor and shim.*

Pre-Series 90 588 / 489 Serialized 0001-2931DK to 0001-3098AN

ORDER: 801,201,15x.x1 Pre-Series 90 Vend Rotor
431,010,05x.x3 Can Stop Shim 588/489




**Rotor, Pre-Series 90
Figure 1**

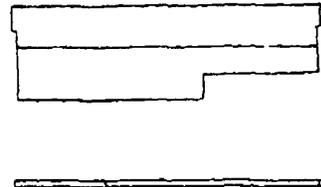

**Can Stop Shim
Figure 2**

Series 90 588 / 489 Serialized 0001-3098AN and Higher

ORDER: 801,201,23x.x1 Series 90 Vend Rotor

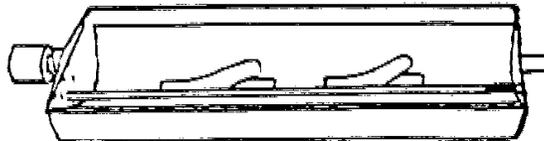

**Figure 3
Rotor, Series 90
(direct drive)**