

# Technical Bulletin

Bulletin Number: 400 Revision Number: R-02

Release Date: June 13, 1990 Revision Date: August 4, 1998

**SUBJECT:** 588/489 NARROW COLUMN CAN STOP SHIM

**MODELS AFFECTED:** All DNCB 588 and 489 Venders


**SERIAL BREAK:** 0001-3156DN to 0001-3203DO

**REASON:** To provide a shim that prevents the second and/or third can from standing up and jamming.

**ORDER:** 431,010,09x.x3 588/489 Can Stop Shim

**To install:**

1. Remove the existing can stop shim (431,010,05x.x3) from the narrow column. The 431,010,05x.x3 can stop shim was factory installed in venders serialized 0001-3156DN to 0001-3203DO.
2. Place the new can stop shim (431,010,09x.x3) on the right side of each narrow column.
3. The new shim allows more clearance for the cans to drop.

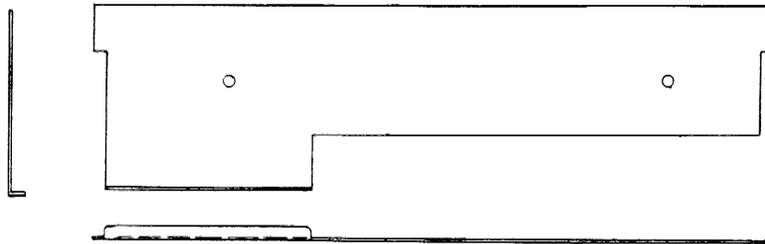

431,010,09x.x3  
588/489 CAN STOP SHIM