

# Service Bulletin

12955 Enterprise Way  
Bridgeton, MO 63044-1200


Technical Service (888) GPL-LINE  
Parts (800) 621-7278  
Parts Fax (800) 531-2580  
General Information (800) 325-8811

**Issue 108**

**December 16, 1998**

It is possible on a 427 Food King to plug the membrane switch assembly (P/N 9984625) onto the controller PCB (J46) in a reversed position. In other words, the blue connector can be plugged in either direction. The symptom encountered is the selection buttons will do nothing when pressed or both the "exact change" and "selection price" LED's will light up.

The proper way for the plug to be connected is with the connector end of the membrane rolled over. (See diagram below). To eliminate the possibility of an incorrect connection a new membrane switch assembly (P/N 9984621) is being made available with the connector end pre-rolled and held in place by an adhesive strip. Please note the original part works fine when connected properly. There is no need to replace the existing part.

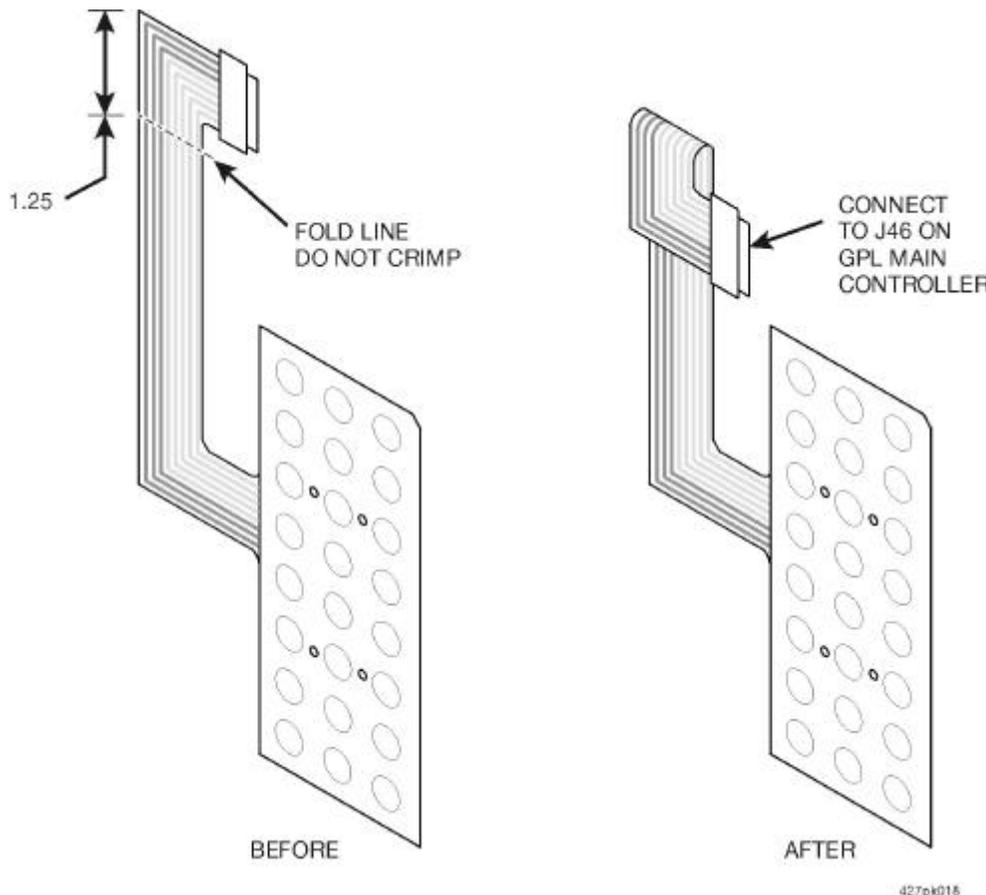

Scott Kearns  
GPL Service