

Technical Bulletin

Bulletin Number: 358 Revision Number: R-05

Release Date: April 4, 1988 Revision Date: November 3, 1998

SUBJECT: COIN INSERT COVERS (COCA-COLA)


MODELS AFFECTED: All Coca-Cola Venders

REASON: To provide extra strength and security to the coin insert.


Order the parts needed from the list provided.

- | | |
|--------------------|--|
| 1 - 432,017,40x.x4 | Landscape coin insert cover with lock cover kit [Kit includes plate assembly (432,017,50x.x3), nuts, and bolts] |
| 1 - 000,005,87x.x6 | Landscape coin insert cover without correct change light hole |
| 1 - 000,005,63x.x6 | Landscape coin insert cover with correct change light hole |
| 1 - 000,005,89x.x6 | Flat Coca-Cola coin insert cover without correct change light hole |
| 1 - 000,010,10x.x6 | Flat Coca-Cola coin insert cover for coin-less venders |
| 9 - 900,201,17x.x1 | Carriage bolt, 1/4 - 20 x 1" |
| 9 - 900,800,67x.x1 | Nut, 1/4 - 20 |


For coin insert cover installation instructions see page 2.

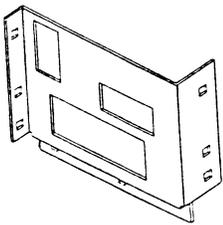


000,005,87x.x6

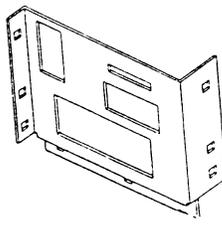


000,005,63x.x6

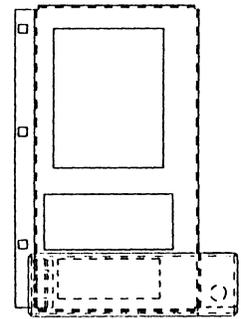

432,017,50x.x3

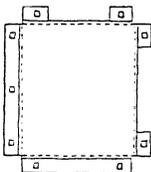

000,010,10x.x6

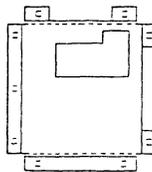

000,005,89x.x6

INSTALLATION INSTRUCTIONS:

1. Unplug the vender.
2. Place the coin insert cover to be used over the coin insert.
3. Align all the cover openings with the openings and parts affected on the coin insert.
4. Ensure that the T-Handle pops out cleanly. Adjust the cover if necessary at this time.
5. Using the cover as a template, mark the holes to be drilled.
6. Remove the cover from the insert.
7. Drill the required 5/16" ID holes.

Caution: Be careful not to drill in to any wiring, parts, or accessories.

8. Place the cover in position and secure with carriage bolts and nuts.
9. Test the T-Handle, coin return plunger, coin slot for coin insertion, and correct change light for proper operation.
10. Plug in the vender and test for proper operation.