Dixie-Narco



(304) 725-3481 (800) 624-0553

Ranson, West Virginia 25438

Service Bulletin

311

Date: December 23, 1986

MODEL: DNCB CC Coke Venders

<u>SUBJECT</u>: Installation

Maka Validator Model: NB15A

REASON: To provide parts which will enable Coca-Cola bottlers to install

subject validator in the New DNCB CC Coke Venders.

PARTS NEEDED: 1 A432,010,010.03 Validator Mounting Ring (Fig. 1)

4 2 900,800,500.01 Keps Nut 8-32

1 B432,050,470.03 POS Window Retainer (Fig. 2)

DO THIS: 1. Remove the Validator cover plate from the vender's Main Door.

2a. Remove the two (2) Coin Insert Retainers - Fig. 3.

b. Replace these with POS Window Retainer - Fig. 2.

3a. Some Venders will have a Coin Insert Retainer which is almost identical to Fig. 2.

b. If the Vender's Serial Number is not 0001-2967 or higher, replace the Retainer.

4a. Install the Validator Mounting Ring (bottom down - Fig. 1) in the opening from which the Validator Cover Plate was removed.

b. Once inserted, install two (2) keps nuts (as spacers) on bottom studs.

5a. From the rear of the Main Door, align the nose piece of the Validator with the Validator opening, and push through.

b. Align Validator holes with Mounting Ring Studs and secure Validator with Keps Nuts.

Service Bulletin #311


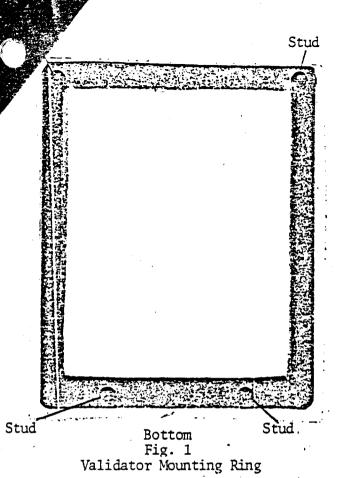




Fig. 3 Coin Insert Retainer

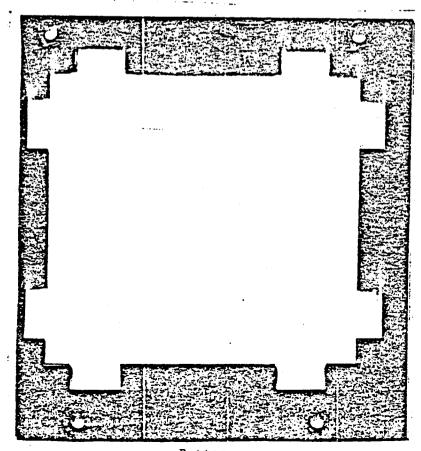

Bottom Fig. 2 POS Window Retainer

D--- 2 -- 2