

Technical Bulletin

Bulletin Number: 376 Revision Number: R-02

Release Date: November 11, 1988 Revision Date: August 25, 1998

SUBJECT: PLASTIC DRAIN TUBE FOR CONDENSATE

MODELS: All Dixie-Narco Can/Bottle Venders

REASON:

1. To start using the plastic drain tube in production venders to provide a more durable part.
2. To facilitate replacement of a broken or bent copper drain tube in the field.


BEGINNING SERIAL NUMBER: 0001-3098AN and higher

PART NUMBER:


1 -B801,806,05x.x1	Plastic Drain Tube
1 - 900,301,79x.x1	Nut, Drain Tube

INSTRUCTIONS TO REPLACE COPPER DRAIN TUBE

1. Remove damaged or existing drain tube.
2. Insert the plastic drain tube (from the top) in the location from which copper tube was removed.
3. Push downward until the threaded area of drain tube makes contact.
4. Put silastic sealer beneath the flange of the drain tube (enough to seal).
5. Turn the tube clockwise, thread it downward until the flange of the drain tube seals against the tank. Secure with nut.
6. Reinstall the flexible drain hose on the drain tube.

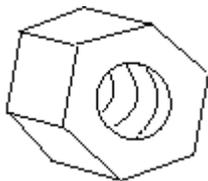

Drain Tube Nut
900,301,79x.x1

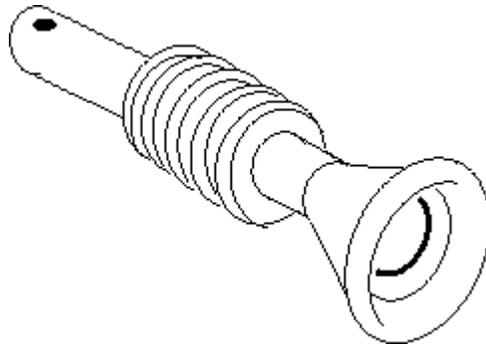

Plastic Drain Tube
801,806,05x.x1